

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	Ø312-11
Description	TRSDOS
Model	Model III
Stock No.	26-Ø312 Version 1.3
Date	November 9, 1982
Page 1 of	1

Problem

In the Basic Language Reference Manual (26-2112, Model III), in the section entitled "Using the RS-232 C Interface", the word bit codes are incorrect. The bit pattern of WORD=6 and WORD=7 is inverted.

* * THE FOLLOWING PATCHES ARE REQUIRED! * *

Solution

At TRSDOS Ready, apply the following patches.

PATCH *9 (ADD=5DCE,FIND=4Ø,CHG=2Ø)

PATCH *9 (ADD=5DD5,FIND=2Ø,CHG=4Ø)