

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	1507-03 (Correction 1)
Description	STOCKPAK
Model	Model III
Stock No.	26-1507 Version 3.0
Date	March 12, 1982
Page 1 of	1

Problem

Erratic performance on printed reports (syntax errors, reboot, etc.).

Solution

The problem is corrected by following the steps listed below.

1. Backup the diskette(s) and make the changes on the Backup copy of the program.
2. In BASIC load the program by typing LOAD"PTREPORT".
3. Make the following corrections:

CHANGES (Retype the line or refer to the Edit section of the owners manual)

Old Line: 350 IFPEEK(16425)>50THENLPRINTCHR\$(12);:Q%=Q%+1ELSERETURN

New Line: 350 IFPEEK(16425)>50THENLPRINTCHR\$(12);:POKE16425,1:
Q%=Q%+1ELSERETURN

ADD this line: 7 POKE16412,255

4. Type SAVE"PTREPORT" to save the changes in the program.
5. In BASIC load the program by typing LOAD"REPRUN/BAS".
6. Add the following lines.

New Line: 5 POKE16412,255

New Line: 1503 POKE16425,1

7. Type SAVE"REPRUN/BAS" to save the changes in the program.
8. At TRSDOS READY, make a backup copy of the corrected diskette.