

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4515-02
Description	PROFILE PLUS
Model	Model II
Stock No.	26-4515 Version 1.0
Date	Sept. 15, 1982
Page 1 of	1

Problem

Specifying RG for range selection will not work properly when associated fields are used. All appropriate records may not be selected. The scan will be terminated prematurely by a member of the associated group that is higher than the end of the range.

* * THESE PATCHES ARE REQUIRED! * *

Solution

The following patches should be applied to the PROFILE PLUS Master Diskettes as soon as possible.

At TRSDOS READY, apply these patches.

PATCH CLERK/EFC A=5879 F=C30B58 C=C39364

PATCH CLERK/EFC A=6493 F=00000000000000000000000000000000 C=2A5B4D2B225B4DC3DB57