

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4517-Ø1
Description	Profile Plus Upgrade
Model	Model II
Stock No.	26-4517 Version 1.Ø
Date	September 15, 1982
Page 1 of	1

Problem

Record selection is incorrect if scan mode is entered before any record has been displayed on the screen, and then CTRL R (recalculate) is used.

* * THIS PATCH IS REQUIRED! * *

Solution

At TRSDOS READY, apply the following patch directly to the PROFILE PLUS SYSTEM UPGRADE (26-4517) Master Diskette prior to the upgrade:

PATCH EDIT A=8132 F=C27C58 C=C2A15D

Or, apply the following patch to all upgraded PROFILE PLUS Diskettes:

PATCH CLERK/EFC A=8132 F=C27C58 C=C2A15D