

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

| | |
|---------------------|------------------------|
| Bulletin No. | 4517-02 (Correction 1) |
| Description | PROFILE PLUS |
| Model | Model II |
| Stock No. | 26-4517 Ver. 01.00.00 |
| Date | May 4, 1983 |
| Page 1 of | 1 |

Problem

* This Customer Service Bulletin applies to Version 01.00.00. See CSB 4517-03 for the same problem on Version 01.01.00

Individual record suppression (CTRL-9) in detail lines of a report causes an unexpected title print every 249 records.

* * THE FOLLOWING PATCHES ARE REQUIRED! * *

Solution

Apply the patches to the Profile Plus master diskette and working copies that were created when the upgrade (26-4517) was applied to Profile (26-4512).

Version 01.00.00 of Profile Plus

1. Install all previous required patches.
2. To install the version number, apply the following patch.

PATCH M A=3995 F=2020202020202020 C="01.00.01"

3. If you have no version number on the first Profile Plus Menu and the update date of PRINT/EFC on the original diskette is later than 02/16/82, apply the following patches to correct the problem.

PATCH PRINT/EFC A=29F2 F=CAF929 C=CA355E

PATCH PRINT/EFC A=5E35 F=000000000000000000000000 C=2A2B442B222B44C3F929

4. If you have an earlier version of PRINT/EFC, apply the following patches to correct the problem after following steps 1 and 2.

PATCH PRINT/EFC A=29F1 F=CAF829 C=CA355E

PATCH PRINT/EFC A=5E35 F=000000000000000000000000 C=2A2B442B222B44C3F829

After patches from this Bulletin have been applied, the version number will be 01.00.01. Please make the necessary entry in your Version Log.