

# CUSTOMER SERVICE BULLETIN

## Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	491Ø-21
Description	TRSDOS
Model	Model II
Stock No.	26-491Ø Ver. 2.Ø/2.Øa
Date	Feb. 9, 1982
Page 1 of	1

### Problem

For some ranges of values, the "RAM Directory" Supervisor call (#53) returned an erroneous value for the number of records in the file. This was caused by an invalid offset in one fo the operands in the calculation.

### Solution

The following patch is for TRSDOS 2.Ø and 2.Øa only and will correct the code involved in the calculation.

```
PATCH SYSTEM/SYS R=59 B=1Ø3 F=B52811 C=CD9926
PATCH SYSTEM/SYS R=59 B=12Ø F=CF5DEB C=CD9F26
PATCH SYSTEM/SYS R=6Ø B=154 F=E5E5E5E5E5E5E5E5E5E5E5
C=B5CA7A252BC9CF5D13EBC9
```